

VIN JTEBU11F670010432
Build Date: 3/2006
GJ515L-GKASKA
FJ CRUISER GSJ15L-GKASKA GSJ1# 03.2006 2JR FA11 01.2006 - 07.2014 ATM,MTM: AUTOMATIC TRANSMISSION;

\$5300/- parts



Date	Mileage	Service	Parts	Remarks
10/13/19	114,288	Baseline Service:	Parts \$485	
		BG Engine cleaning treatment	Used BG EPR before oil change 11oz	
		LOF	Changed Oil M1-5/30 Toyota 90915VZD03 Filter	5.0qts
			Added BG MOA with oil: 11oz	
		Lube front & rear drive shaft	Valvoline power syn- moly	
		Lube front & rear upjont spiders	Green Grease	
		Replaced rear diff fluid	80w/90 Dino oreily master pro GL5 3.1 qts (added LS additive)	replaced fill & drain plug crush washer
		Replaced front diff fluid	80w/90 Dino oreily master pro GL5 1.5qts	replaced fill & drain plug crush washer
		Replaced front TC fluid	Mobil 1 75/90 Syn 1.4qts	
		Greased TRE	Green Grease	
		Greased 2 lower control arms	Green Grease	
		Reclamped DS inner boot	NAPA CV Clamp Small CVB 6865833	added small amount of green grease, 10 squirts. Cleaned LCA area.
		Cleaned TB, air box and intake		
		Install New Airfilter	Toyota 17801-0P010	
		Install New Cabin Airfilter	Denso	
		Coolant Flush	Toyota Pink SLLC2 2.5 gallons	drained radiator, refilled with distilled water, drained again, refilled with coolant, ran engine, drained radiator refilled with coolant and burped.
		Flushed power steering circuit	M1 SYN ATF 2qts	Flushed, cleaned reservoir,
		Checked Brake Fluid Condition	1% moisture or less: Good	
		Replaced Spark Plugs	90919-01235 Toyota. (Checked gap all 1.1)	Old plugs appeared original: 3 Denso/3 NGK(all gaps were 1.6+).
		Replaced PCV	12204-31030 4.65	
		Trans Drain & Fill - multiple	3.2qts round 1, 3 qts md 2, 3 qts md 3, 3.5qts #4, 2.5qts	4 x drain & refills
		Replaced Rear Brake pads- Brake Fluid System Flush	(advance auto) Carquest Wearaver Platinum Professional Ceramic Brake Pads - Rear (4-Pad Set) PXD606H (new 14mm) \$42.39 with disc., Valvoline synthetic DOT3/4 Fluid 1.5 qts	
			Rotors spec'd: DS 17.57"-17.53mm PS 17.44"-17.38mm. had them turned at NAPA \$20 ea. New is 18mm and 16mm is limit	
10/28/19	114,446	Installed Ironman Foam Cell Pro rear shocks	Ironman FPC 45682FEC. \$498	replaced all mounting hardware with TOYOTA hardware
		Installed Sky Jacker extended sway bar links- rear	SBE702 \$75.59	90119-A0018 shock bolt
		Replaced window belt weather strip back door DS & PS	6816335041, 6816435041 \$20.57ea	
11/9/19	114, 713	Installed Transmission Oil cooler	Long LPD 4454 Transmission Cooler 18,000 LB Low Pressure Tru Cool Long MFG (OC-4454) \$49.95	
		Flushed entire transmission system-(at radiator retrun)	6' Extra trans cooler line \$18	
		performed level check procedure	16qts AISIN WS \$96, fresh washers, new drain plug.	Removed return line, engine on method. Performed level check procedure.
11/15/19	114,759	Installed Ironman Foam Cell Pro front suspension- w/constant load coils	2 Ironman FCP 45710FE- & TOY55C Springs. \$1035	Toyota hardware: 90105-14104 LCA shock mount bolt, 90170-14032- strut nut, 94622-41400- strut washer
		New KYB strut retainers	2. KYB strut retainer KYB SM5640 18.33 ea	
		Installed SPC Upper Control Arms	SPC25480 \$589.46	L R
		Installed ICON Sway bar mount relocation	ICO611030 \$52.78	Camber. -.02. 0.0
		Instaled new sway bar links	Duralast: SL10450. SL10460 \$1.70	Caster. 4.3. 4.6
		Alignment & adjust rear lower contol arms	Grand Turismo \$135	Toe. -.001. 0.00
		Installed AGM Aux battery with Off grid Eng. Battery Holder	\$164 battery, \$172 battery holder	SAI. 12.1 11.9
11/23/19	114,830	Install Trail Tailor Rear Lower Control Arms	Custom made: \$340 Currie JJ,	Updaed alignment \$135- adjust rear axle thrust angle. Added length approx 1/2" to PS
12/14/19	115,130	Icon Adjustable Rear Track bar 54200 \$315	Adjusted 1/8"	
		Armored 40" Light bar installed \$200		
		Removed cable rope and replaced with 100' 3/8" Dyneema winch line 23.8K		
		Factor 55 offset fairlead \$120		
		Factor 55 Flat link \$150		
		WetOkole Front Seat Covers-\$324		
3/27/20	115,740	R&R Alternator	Denso Reman P/N 210-1100. \$113 + Core shipping & tax 210.32 > \$75 return core credit RockAuto	Battery warning light illuminated, checked all electrical systems and confirmed ALT was source of issue. Charging voltage erratic and 12.2,12.3 V @2000 rpm
		Replaced serpentine accessory belt	BANDO 7PK2120 \$17.86	Groaning noise present. Removed serpentine belt and inspected pulleys as well. None replaced.
				Installed denso reman 100A alternator & new serpentine belt.

Spend To Date \$5300