

SERVICE HISTORY FOR: 2005 LX470**VIN:** JTJHT00W953549875

293963 MILES**DATE:** 06/2020

SERVICE: COMPLIMENTARY CAR WASH FROM
HILTON HEAD LEXUS VALUED \$ 29.95

DESCRIPTION: COMPLIMENTARY CAR WASH FROM
HILTON HEAD LEXUS VALUED \$ 29.95
~|~COMPLIMENTARY CAR WASH FROM HILTON
HEAD LEXUS ~|~

SERVICE: SHOP SUPPLIES HILTON HEAD LEXUS A
VARIETY OF SHOP SUPPLIES ARE CONSUMED WHEN
WE

DESCRIPTION: SHOP SUPPLIES HILTON HEAD
LEXUS A VARIETY OF SHOP SUPPLIES ARE
CONSUMED WHEN WE ~|~THE FEE THAT WE
CHARGE IS 18% OF THE LABOR CHARGE UP TO A
MAXIMUM OF \$38.00 ~|~

SERVICE: I ACKNOWLEDGE THAT I HAVE REMOVED
ALL PERSONAL ITEMS FROM MY VEHICLE
INCLUDING M

DESCRIPTION: I ACKNOWLEDGE THAT I HAVE
REMOVED ALL PERSONAL ITEMS FROM MY VEHICLE
INCLUDING ~|~ ~|~NO CAUSE SPECIFIED IN RO

SERVICE: TELL US MORE

DESCRIPTION: TELL US MORE ~|~CUSTOMER
REQUESTS INSTALL TRAILER HITCH. PART IS IN
STOCK ~|~ ~|~INSTALLED NEW HITCHTELL US MORE
~|~CUSTOMER REQUESTS REPLACE PASSENGER SIDE
REAR BRAKE LIGHT BULB. ~|~ ~|~COULD NOT
INSTALL BULB DUE TO HAVING CONNECTOR TO
BULB BEING BLOWN OUT. CUSTOMER WILL ORDER
NEW PART WHEN HE GETS HOME

260503 MILES**DATE:** 06/2020

SERVICE: COMPLIMENTARY CAR WASH FROM
HILTON HEAD LEXUS VALUED \$ 29.95

SERVICE: INSPECT DRIVERS SIDE FLOOR MAT.
SAFETY IS OUR PRIORITY, FLOOR MAT SHOULD
ALWAYS

DESCRIPTION: COMPLIMENTARY CAR WASH FROM
HILTON HEAD LEXUS VALUED \$ 29.95 ~|~|~NO
CAUSE SPECIFIED IN RO
SERVICE: TELL US MORE
DESCRIPTION: TELL US MORE ~|~CUSTOMER
REQUESTS ORDER TRAILER HITCH ~|~

DESCRIPTION: INSPECT DRIVERS SIDE FLOOR MAT.
SAFETY IS OUR PRIORITY, FLOOR MAT SHOULD
ALWAYS ~|~|~NO CAUSE SPECIFIED IN RO
SERVICE: TEXT MESSAGE COMMUNICATION
AUTHORIZATION-YOU AGREE THAT WE MAY
CONTACT YOU REGARD
DESCRIPTION: TEXT MESSAGE COMMUNICATION
AUTHORIZATION-YOU AGREE THAT WE MAY
CONTACT YOU ~|~|~NO CAUSE SPECIFIED IN RO

260001 MILES**DATE:** 06/2020

SERVICE: COMPLIMENTARY CAR WASH FROM
HILTON HEAD LEXUS VALUED \$ 29.95
DESCRIPTION: COMPLIMENTARY CAR WASH FROM
HILTON HEAD LEXUS VALUED \$ 29.95
~|~COMPLIMENTARY CAR WASH FROM HILTON
HEAD LEXUS ~|~
SERVICE: SHOP SUPPLIES HILTON HEAD LEXUS A
VARIETY OF SHOP SUPPLIES ARE CONSUMED WHEN
WE
DESCRIPTION: SHOP SUPPLIES HILTON HEAD
LEXUS A VARIETY OF SHOP SUPPLIES ARE
CONSUMED WHEN WE ~|~THE FEE THAT WE
CHARGE IS 18% OF THE LABOR CHARGE UP TO A
MAXIMUM OF \$38.00 ~|~

SERVICE: I ACKNOWLEDGE THAT I HAVE REMOVED
ALL PERSONAL ITEMS FROM MY VEHICLE
INCLUDING M
DESCRIPTION: I ACKNOWLEDGE THAT I HAVE
REMOVED ALL PERSONAL ITEMS FROM MY VEHICLE
INCLUDING ~|~|~NO CAUSE SPECIFIED IN RO
SERVICE: TELL US MORE
DESCRIPTION: TELL US MORE ~|~CUSTOMER
REQUESTS ORDER TRAILER HITCH ~|~

284275 MILES**DATE:** 11/2019

SERVICE: CUSTOMER CONCERNS**DESCRIPTION:** CUSTOMER CONCERNS~|~|~|~|~**SERVICE:** MISC. SHOP CHARGES**DESCRIPTION:** MISC. SHOP CHARGES~|~|~|~

~|~MISC. SHOP CHARGES~|~|~|~|~

SERVICE: FEE CODE**DESCRIPTION:** FEE CODE~|~|~|~|~

281833 MILES**DATE:** 10/2019**SERVICE:** 15000 MILE PREMIUM SERVICE**DESCRIPTION:** 15000 MILE PREMIUM SERVICE~|~|~|~

~|~281833 15K PRE 210 PERFORMED 15000
MILEPREMIUM SERVICE CHANGE OIL AND
FILTERINSPECT BRAKES SYSTEM FOR WEAR AND
LEAKSROTATE AND BALANCE TIRES ADJUST
TIREPRESSURE PERFORM THROTTLE SERVICE
INSPECTDRIVE BELTS FOR CRACKING AND WEAR
INSPECTFRONT SUSPENSION

SERVICE: BRAKES FRONT REPLACE**DESCRIPTION:** BRAKES FRONT REPLACE~|~|~|~

~|~281833 FRONT BRAKES AND ROTORS 200
REPLACEDFRONT BRAKES AND ROTORS REPACKED
BEARINGS

SERVICE: FEE CODE**DESCRIPTION:** FEE CODE~|~|~|~|~**SERVICE:** BELT REPLACE**DESCRIPTION:** BELT REPLACE~|~|~|~|~281833

TIMING BELT PACK 650 REPLACED TIMINGBELT AND
WATER PUMP

SERVICE: CUSTOMER CONCERNS**DESCRIPTION:** CUSTOMER CONCERNS~|~|~|~

~|~281833 AXLE 200 REPLACED AXLECUSTOMER
CONCERNS~|~|~|~|~281833 POWER STEERING LEAK
200 REPLACED PSLINES

SERVICE: MISC. SHOP CHARGES**DESCRIPTION:** MISC. SHOP CHARGES~|~|~|~

~|~MISC. SHOP CHARGES~|~|~|~|~

281834 MILES**DATE:** 09/2019

SERVICE: 15000 MILE PREMIUM SERVICE

DESCRIPTION: 15000 MILE PREMIUM SERVICE~|~ ~|~

~|~

259971 MILES

DATE: 07/2018

SERVICE: OTHERS

DESCRIPTION: OTHERS ~|~ ~|~BATTERY FAILED

TEST ~|~CHECK SYSTEM REPLACE BATTERY

SERVICE: SEE SECTION

DESCRIPTION: SEE SECTION ~|~A/C NOT COOLING

~|~CHECK AC OPERATION ~|~PERFORM DRAIN
EVAC AND RECHARGE ADD DYE INSPECT SYSTEM
FOR LEAKS CHECK FOR CODES CHECK FOR PROPER
SETTINGS AC SYSTEM IS OPERATING CORRECTLY AT
THIS TIME

SERVICE: STEERING WHL/MAIN SHAFT

DESCRIPTION: STEERING WHL/MAIN SHAFT

~|~TOWED IN CAN NOT TURN STEERING
WHEEL,DIFF LIGHT IS ON,VSC LIGHT ON / SEE TODD
~|~CHECK FOR NO POWER STEERING INTERNAL
MALFUNCTION IN STEERING RACK ~|~PERFORM
HEALTH CHECK PERFORM P/S PRESSURE TEST AT
THE PUMP 200 PSI AT IDLE INDICATING A
RESTRICTION CHECK PRESSURES AT THE STEERING
RACK THEY ALSO INDICATE A GOOD PUMP AND A
INTERNAL RESTRICTION IN THE RACK PERFORM
MULTIPLE SYSTEM FLUSHES TO CLEAR OUT THE

242779 MILES

DATE: 05/2017

SERVICE: ALIGN 4 WHEELS

DESCRIPTION: ALIGN 4 WHEELS ~|~CUSTOMER REQUEST 4 WHEEL ALIGNMENT ~|~PREVENTATIVE TIRE MAINTANENCE ~|~COMPLETED 4 WHEEL ALIGNMENT & SET TO FACTORY SPECIFICATIONS.

SERVICE: MULTI POINT INSPECT

DESCRIPTION: MULTI POINT INSPECT ~|~CUSTOMER REQUEST FREE MULTI-POINT SAFETY INSPECTION ~|~PERFORM FREE MULTI-POINT SAFETY INSPECTION ~|~PERFORMED FREE MULTI-POINT SAFETY INSPECTION

SERVICE: SEE SECTION

DESCRIPTION: SEE SECTION ~|~AC DOESNT COOL ~|~ ~|~R&R COMPRESSOR, DRYER, "O" RINGS AND VACUUM, ADD DYE & RECHARGE TO FULL STATE. A/C WORKING AS DESIGN RIGHT NOW HAVE RAY TEST DRIVE THOROUGHLY BEFORE SHIPPING

SERVICE: GX-CSA AIRBAG MODULE**DESCRIPTION:** GX-CSA AIRBAG MODULE

~|~CUSTOMER REQUEST THE GLB CURTAIN-SHIELD AIRBAG MODULE SAFETY RECALL CAMPAIGN. ~|~PERFORM THE LEXUS GLB CURTAIN-SHIELD AIRBAG MODULE SAFETY RECALL CAMPAIGN. ~|~PERFORMED THE LEXUS GLB CURTAIN-SHIELD AIRBAG MODULE SAFETY RECALL CAMPAIGN.

SERVICE: REPLACE 4 TIRES

DESCRIPTION: REPLACE 4 TIRES ~|~CUSTOMER REQUEST 4 TIRES REPLACED ~|~ ~|~4 TIRES REPLACED DOT=B73A005X4916 (4) ALL ROAD FORCE BELOW 15 LBS.

230511 MILES**DATE:** 02/2016**SERVICE:** DIAGNOSE FOR REPAIRS

DESCRIPTION: CHECK A/C SYSTEM. CUST STATES A/ C NOT BLOWING COLD ON TRIP DOWN TO COLUMUS YESTERDAY ~|~ ~|~

SERVICE: MISC MISC

DESCRIPTION: APPOINTMENT DID NOT ROLL OVER ~|~ ~|~

184944 MILES**DATE: 11/2013****SERVICE:** 90K MILE SVC**DESCRIPTION:** 90K MILE SVC ~|~CUSTOMER

REQUESTS 180,000 MILE SERVICE AND INSPECTION - ADVISED OF ADDITIONAL COST FOR WATERPUMP AND SEALS - NEED TO FINISH CAR BY BY DAYS END FOR RETURN TRIP HOME ~|~CUSTOMER REQUESTS A 90K MILE SERVICE ~|~90,000 MILES OR 108 MONTHS SERVICE AT 90000

SERVICE: MULTI POINT INSPECT**DESCRIPTION:** MULTI POINT INSPECT

~|~CUSTOMER REQUEST FREE MULTI-POINT SAFETY INSPECTION ~|~PERFORM FREE MULTI-POINT SAFETY INSPECTION ~|~PERFORMED FREE MULTI-POINT SAFETY INSPECTION

SERVICE: RADIATOR ASSEMBLY**DESCRIPTION:** RADIATOR ASSEMBLY ~|~TECH

NOTED DURING SERVICE INSPECTIONS THAT THE RADIATOR TANK WAS LEAKING ANTIFREEZE - CUSTOMER APPROVED ~|~COMPONENT DETERIORATION NOT UNCOMMON FOR MILEAGE ~|~REPLACED RADIATOR RENEWED ANTIFREEZE AND BLED AIR FROM SYSTEM - RECHECKED GOOD

SERVICE: DISTRIBUTOR/HDLIGHT/T. SGNL**DESCRIPTION:** DISTRIBUTOR/HDLIGHT/T. SGNL

~|~CUSTOMER STATES THERE IS A BULB OUT BELOW THE HEADLIGHT ON THE DRIVERS SIDE - ADVISE ~|~DRIVERS SIDE FOG LIGHT BULB IS INOP ~|~REPLACED LEFT FRONT FOG LIGHT BULB

SERVICE: NON-OEM THEFT DETERRENT SYSTEM

INSTALL/R&R

DESCRIPTION: NON-OEM THEFT DETERRENT SYSTEM INSTALL/R&R ~|~CUSTOMER REQUESTS NEW SHELL KEY TO REPLACE EXISTING CRACKED KEY WITH CAR ~|~ ~|~COMPLETED

SERVICE: WATER PUMP**DESCRIPTION:** WATER PUMP ~|~TECH ALSO

ADVISED AFTER DISASSEMBLY THAT THE WATERPUMP AND FRONT CRANKSHAFT SEALS WERE SEEPING FLUIDS - BELT CRACKED-OK ~|~WORN COMPONENTS THAT WERE LEAKING COOLANT AND ENGINE OIL - (NOT UNUSUAL FOR MILEAGE ACCRUED AND AGE OF COMPONENTS) ~|~REPLACED WATER PUMP, FRONT CRANK SEAL AND DRIVE BELT

162240 MILES**DATE: 01/2013**

SERVICE: FRONT/REAR BODY

DESCRIPTION: FRONT/REAR BODY ~|~CHECK ALL MUD FLAPS ~|~RIGHT REAR MUD FLAP IS HANGING ~|~INSTALL CLIP. HIT SOMETHING AND LOST ONE HOLDER BUT REPAIRED BEST POSSIBLE

SERVICE: MISC

DESCRIPTION: MISC ~|~CUSTOMER STATES THAT ANTENEA WILL NOT ROLL UP ~|~ANTENNA WAS MANUALLY DOWN ALL THE WAY. SO WHEN RADIO WAS ON ANTENNA STAYED DOWN. ~|~WHILE RADIO ON. MANUALLY PUT ANTENNA ALL THE WAY UP. TURNED OFF AND ON GOES DOWN ALL THE WAY AND GOES UP ALL THE WAY AUTOMATICALLY.

SERVICE: LX470 SAFETY RECALL

DESCRIPTION: LX470 SAFETY RECALL ~|~CUSTOMER REQUEST THE LX470 SAFETY RECALL CAMPAIGN ~|~PERFORM LEXUS SAFETY RECALL CAMPAIGN ALF FOR LX470 ~|~PERFORMED THE LEXUS LX470 ALF SAFETY RECALL CAMPAIGN

70171 MILES**DATE:** 08/2008**SERVICE:** 60000 MILE SERVICE NON WARRANTY

DESCRIPTION: 60000 MILE SERVICE NON WARRANTY ~|~CUSTOMER REQUESTS 60000 MILE SERVICE ((NITROGEN IN TIRES-DO NOT AIR TIRES)) ~|~SCHEDULED MAINTENANCE DUE TO TIME OR MILEAGE ~|~60K SERVICE 04/UP

SERVICE: WHEEL ALIGNMENT

DESCRIPTION: WHEEL ALIGNMENT ~|~CUSTOMER REQUEST 4 WHEEL ALIGNMENT ~|~PREVENTATIVE TIRE MAINTANENCE ~|~COMPLETED 4 WHEEL ALIGNMENT & SET TO FACTORY SPECIFICATIONS.

SERVICE: NON-OEM THEFT DETERRENT SYSTEM INSTALL/R&R

DESCRIPTION: NON-OEM THEFT DETERRENT SYSTEM INSTALL/R&R ~|~KEY HOUSING IS BROKEN ~|~CUT NEW KEY

50676 MILES**DATE: 08/2007**

SERVICE: 50000 MILE SERVICE NON WARRANTY-
NON OEM

DESCRIPTION: 50000 MILE SERVICE NON
WARRANTY-NON OEM ~|~CUSTOMER REQUESTS
50000 MILE SERVICE ~|~SCHEDULED MAINTENANCE
DUE TO TIME OR MILEAGE ~|~50K SERVICE

SERVICE: OTHERS

DESCRIPTION: OTHERS ~|~FRT BRAKES ~|~WORN
PADS AND WARPED ROTORS ~|~REPLACED FRONT
PADS AND MACHINED ROTORS OTHERS ~|~REAR
BRAKES ~|~|~REPLACED REAR BRAKES AND
MACHINED ROTORS AFTER MACHING REAR
ROTORS TO SPEC UNABLE TO TEST DRIVE DUE TO
TRAFFIC MAY OR MAY NOT NEED ROTORS E E

SERVICE: NON WARRANTABLE OPERATION CODE

DESCRIPTION: NON WARRANTABLE OPERATION
CODE ~|~LFT REAR TIRE LOOSING AIR ~|~
~|~MOUNT AND BALANCE 1 TIRE NON
WARRANTABLE OPERATION CODE ~|~RT REAR MUD
FLAP IS LOOSE ~|~|~TIGHTENED MUD FLAP

41476 MILES**DATE: 02/2007**

SERVICE: FRONT AXLE

DESCRIPTION: FRONT AXLE ~|~CUSTOMER WAS
TOLD BY A TIRE SHOP, STRUT IS CRACKED?
~|~DURING INSPECTION RIGHT FRONT SHOCK WAS
EXCESSIVE IN MOISTURE DUE TO A BAD SEAL
~|~REPLACED THE RIGHT FRONT SHOCK

30185 MILES**DATE: 08/2006**

SERVICE: 30000 MILE SERVICE NON WARRANTY

DESCRIPTION: 30000 MILE SERVICE NON

WARRANTY ~|~CUSTOMER REQUESTS 30000 MILE
SERVICE ~|~SCHEDULED MAINTENANCE DUE TO
TIME OR MILEAGE ~|~30000 MILE SERVICE
PERFORMED

14938 MILES

DATE: 12/2005

SERVICE: CERTIFIED PRE-OWNED PDI

DESCRIPTION: CERTIFIED PRE-OWNED PDI

~|~CERTIFIED PRE OWNED INSPECTION NO OIL-
RECENTLY DONE ~|~INSPECTION NEEDED FOR
CERTIFICATION ~|~001014 CERTIFICATION
INSPECTION

SERVICE: FT PK/COMBO LAMP ASM

DESCRIPTION: FT PK/COMBO LAMP ASM ~|~SP

~|~PARKING LAMP CRACKED

14654 MILES

DATE: 10/2005

SERVICE: 15000 MILE SERVICE NON WARRANTY

DESCRIPTION: 15000 MILE SERVICE NON

WARRANTY ~|~MINI 15K SERVICE ~|~SCHEDULED
MAINTENANCE DUE TO TIME OR MILEAGE ~|~15000
MILE SERVICE PERFORMED

SERVICE: NON WARRANTABLE OPERATION CODE

DESCRIPTION: NON WARRANTABLE OPERATION

CODE ~|~FULL DETAIL

10227 MILES**DATE: 07/2005****SERVICE:** 10000 MILE SERVICE NON WARRANTY-

NON OEM

DESCRIPTION: 10000 MILE SERVICE NON

WARRANTY-NON OEM ~|~CUSTOMER REQUESTS

10000 MILE SERVICE ~|~SCHEDULED MAINTENANCE

DUE TO TIME OR MILEAGE ~|~10K SERVICE

5127 MILES**DATE: 03/2005****SERVICE:** 5,000 MILE SERVICE**DESCRIPTION:** 5,000 MILE SERVICE ~|~CUSTOMER

REQUESTS 5000 MILE SERVICE ~|~SCHEDULED

MAINTENANCE DUE TO TIME OR MILEAGE ~|~5,000

MILE SERVICE ROAD TEST AND BODY INSPECTION.

THIS INCLU DES FACTORY AND HENNESSY LEXUS

RECOMMENDED SERVICE. THESE

RECOMMENDATIONS ARE BASED ON ATLANTA

DRIVING CONDITIONS. FRONT BRAKE PADS WEAR,

REAR BRAKE PAD WEAR, TIRE TREAD DEPTH

READINGS. ROTATION

3699 MILES**DATE: 02/2005****SERVICE:** 1,000 MILE SERVICE

DESCRIPTION: 1,000 MILE SERVICE ~|~CUSTOMIZED
PERSONAL SETTINGS ~|~ ~|~COMPLETED PERSONAL
SETTINGS

6 MILES

DATE: 10/2004

SERVICE: NEW CAR CLEAN UP

DESCRIPTION: NEW CAR CLEAN UP ~|~NEW CAR
CLEAN UP ~|~NEW CAR DEPARTMENT DELIVERY
~|~CLEANED FOR DELIVERY

6 MILES

DATE: 10/2004

SERVICE: MISC

DESCRIPTION: MISC ~|~TURN LEXUS LINK VOICE
OFF AND MAKE LOCKS NOT LOCK WHEN PUT INTO
GEAR ~|~ADJUSTED PERSONAL SETTINGS ~|~001030-
PERSONALIZED SETTINGS

10 MILES

DATE: 10/2004

SERVICE: PRE-DELIVERY SERVICE FOR USA ALL
ALTITUDES

DESCRIPTION: PRE-DELIVERY SERVICE FOR USA

ALL ALTITUDES ~|~PRE DELIVERY INSPECTION

TASTE OF ATLANTA ~|~NEW CAR DELIVERY

~|~001013 PDI USA

TERMS AND CONDITIONS

INFORMATION ACCURACY

Information presented on this website is summarized and standardized from repair orders completed at the time of service and submitted by Lexus dealers. When reviewing a vehicle's service history, please note that all information is provided by the Lexus Dealer that conducted the service, and that dealer is solely responsible for the accuracy, completeness or authenticity of any information contained in this site. Lexus provides this site and all information and materials contained herein as is, without warranty of any kind. Any questions or concerns regarding this information should be addressed to the applicable Lexus dealer.

L/CERTIFIED OWNER INFORMATION

Dealer-reported service history records are linked to a vehicle's Vehicle Identification Number (VIN). All owner-reported service history records will be made available to the person who input the information on the site, but will not be shared with future owners of the vehicle.

OWNER-REPORTED INFORMATION AND PRIVACY TERMS

Lexus makes every effort to ensure the secure collection and transmission of sensitive user information using industry-accepted data collection and encryption methodologies. The information you provide is used by Lexus and its vendors and dealers to help improve the services we render. It is occasionally provided to Lexus dealers for their marketing use. Lexus will never sell your personally identifiable information to any other company. To learn more about our privacy policies and practices with respect to this website, please [click here](http://www.lexus.com/privacy/online-statement) (<http://www.lexus.com/privacy/online-statement>).