

Exterior Rear View Mirror Vibration

Service
Category Vehicle Exterior

Section Mirror (ext)

Market USA

Toyota Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2008 – 2011	Land Cruiser	

Introduction

Some Land Cruiser vehicles may exhibit a condition where the exterior rear view mirror vibrates while driving. A bolt set has been developed to change this condition.

Production Change Information

This TSB applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN
Land Cruiser	Tahara	JTMHY7AJ#B5007783
	Toyota Auto Body	JTMHY7AJ#B4003905

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
N/A	81859-60480	Bolt Set RH	1
N/A	81859-60490	Bolt Set LH	1

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Plastic Pry Tool Set*	<u>00002-06000-01</u>	1

* Essential SST.

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

Exterior Rear View Mirror Vibration

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
BD1102	R & R Bolt Set (one side)	0.4	879#0-60B90	9B	81
Combo A	Opposite Side	0.2			

APPLICABLE WARRANTY

- This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.


Repair Procedure

HINT

Use same procedure for both sides.

1. Using a plastic pry tool, remove the lower base cover from the mirror housing assembly.
2. Remove and replace the 3 torx bolts with the new bolt set. **Figure 1.**

Torque: 3.7 N*m (37.7 kgf*cm, 33 in*lbf)

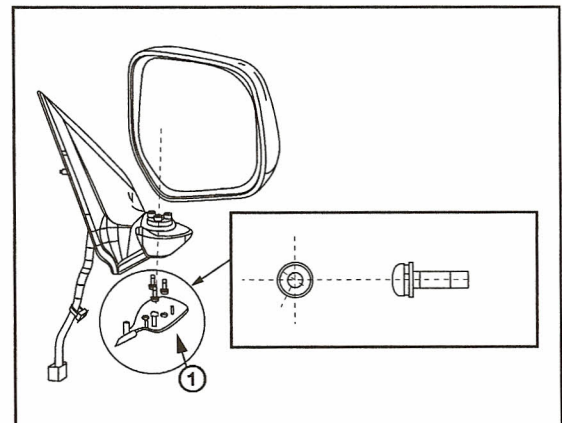

1 Lower Base Cover

3. Replace lower base cover with new one provided in bolt set.
4. Road test vehicle to confirm proper operation of mirror assembly.